

# Easy UPS Online Monitoring Software v2.6-GA-01-23248 Release Notes

## Table of Contents

New Features .....	1
Fixed Issues.....	1
Known Issues.....	2

The Easy UPS Online Monitoring Software v2.6-GA-01-23248 release notes apply to the following cards:

- **APV9601 Easy UPS Online SNMP Card.**
- **APVS9601 Easy UPS Online SNMP Card.**

## New Features

[Top ↑](#)

### New Features

The OpenJDK version bundled with the software is 17.0.4.

## Fixed Issues

[Top ↑](#)

### Fixed Issues

The following security vulnerabilities has been addressed:

- [CVE-2022-31491](#) – Remote Code Execution
- [CWE-22](#) – An improper limitation of a pathname to a restricted directory (Path Traversal) vulnerability

The Easy UPS Online Monitoring software is now compatible with Windows 10, Windows 11, Windows Server 2016, Windows Server 2019, and Windows Server 2022.

The **Purchase Information** screen in the Web UI now displays all information as expected.

The **Systray** icon remains active after several hours of communication while the background UPS service continues to run.

## Known Issues

[Top ↑](#)

Known Issues
In the <b>Email Configuration</b> screen, you cannot use the hyphen character “-“ in the SMTP ID and Email ID fields.
In the <b>Parameter Settings</b> screen, the “Default” button does not function as expected.
The “Battery disconnected” event is not correctly logged in the <b>Events Action</b> screen and the <b>Messages</b> window. <b>NOTE:</b> This issue is only seen with SNMP.
In the <b>Parameter Settings</b> screen, UPS devices SRV10KUXI, SRV15KUXI, and SRV20KUXI do not enter bypass mode when bypass is enabled, and output power is off. <b>Workaround:</b> Power off the device before enabling bypass mode when the UPS is off.
In the <b>Status Diagram</b> screen, the <b>Battery Current</b> for UPS devices SRV10KUXI, SRV15KUXI, SRV20KUXI, 1KRIL, 2KUXI, and 3KRIL are incorrectly displayed as 0.0 Amps.
After a successful self-test, the “Battery self-test passed” event is not logged to the <b>Event Log</b> . <b>NOTE:</b> This issue affects SRV10KUXI, SRV15KUXI and SRV20KUXI devices.
You must manually complete the USB driver installation. For more information, see knowledge base article <a href="#">FAQ000257603</a> .
End of support (EOS) operating systems including Windows 7, 8 and 8.1 are not compatible in this release.
Wake on Lan feature does not function as expected.

Copyright © 2023 Schneider Electric. All rights reserved.

<https://www.apc.com>

990-6471D-001

10-2023