

THORSMAN

Instructions for:

Tripod 4507240G2 for use with
Thorsman worklights Goliath G2,
G2 Pro, G2 Plus and G2 Trade

Please retain for future reference

AR1481 EdA

Positioning and Use

The tripod should always be used on an even level surface, with the legs fully extended and locked. Always pass the worklight cords under the tripod legs.

Do NOT connect tools or appliances to the sockets of any Goliath worklight when mounted on the tripod.


Tighten the mast collars by turning them clockwise. Always fully tighten the collars. When collapsing the mast with the worklights in place untighten the collars slowly and always support each section.

Do not move a fully assembled tripod without first collapsing the mast.

Assembly

If necessary remove the straps from the worklight stand bars. Assemble the brackets to the Goliath stand bars and the tripod crossbar with the screws, nuts and washers as shown opposite; this is best done on a bench or table. For ease of mounting fully collapse the mast.

Unscrew the mast crossbar mounting screw, put the mounting screw through the center hole in the crossbar and lift the crossbar into position. Fully tighten the mounting screw.

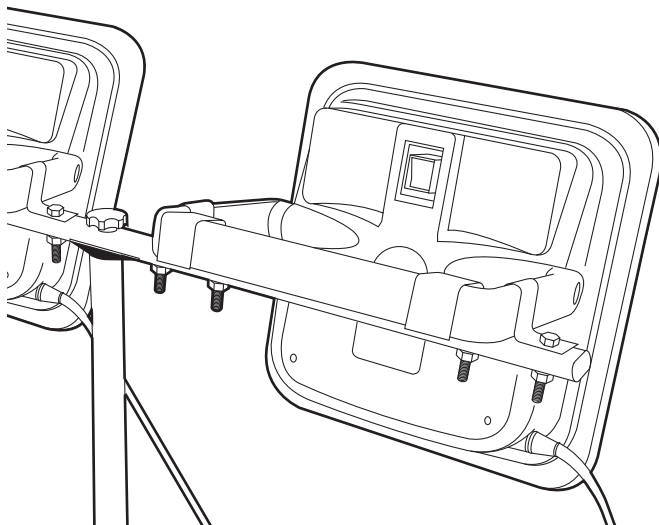

Transportation

When carrying and transporting the tripod with worklights attached it is convenient and safe to undo the mounting screw and leave the worklights on the crossbar.

THORSMAN HELPLINE
01952 209001

THORSMAN

Stafford Park 5, Telford, Shropshire TF3 3BL