

Relè di protezione PowerLogic™ P5. Come passare da banco di taratura gruppo 1 a gruppo 2 da pannello locale

Schneider Electric non si assume alcuna responsabilità per eventuali conseguenze derivanti dall'uso di questo documento. Questo documento è destinato a persone addestrate ed esperte, incaricate dal proprio committente a operare sull'impianto.

Sulla schermata principale
premo il tasto **HOME**.



Con i tasti **FRECCIA**
mi posiziono su **Protection**.



Confermo con il tasto **OK**.



Entro in **Protection** con il
tasto **OK**.



Con il tasto **FRECCIA DX**
vado nella pagina **Protection**
set.



Con il tasto **OK** entro in **Portection set**.



Con i tasti **FRECCIA** mi
posiziono su **Gruop**.



Con il tasto **OK** entro in **Edit set Gruop.**



Con i tasti **FRECCIA** mi
posiziono su **Gruppo 2**.



Con tasto **OK** confermo la scelta del gruppo 2.



Ho così selezionato il gruppo 2.
Premo il tasto **HOME** per 3s per tornare alla schermata iniziale.






Life Is On

Schneider
Electric



Feeder

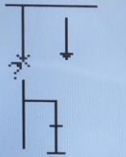

IL1	0 A
IL2	0 A
IL3	0 A
VL1	0 V
VL2	0 V
VL3	0 V
F	--- Hz



Enabled stages 1/6

I>	On
I>>	On
I>>>	On
Iq>	Off
Iq>>	Off
Iq>>>	Off
Iq>>>>	Off
Io>	On



Protection set 2/6

Edit: Set. group common change

1
2
3
4



MIMIC

Mimic Measures Protection Control

User login General Logs Device/Tst



Protection set 2/6

Stages 4

Clear all	-
Clear logs	-
Start counter	0
Trip counter	0
Group	1
SetGrp no ctrl	Keep last
SetGrp priority	1 to 4



Protection set 2/6

Edit: Set. group common change

1
2
3
4



PROTECTION

Mimic Measures Protection Control


User login General Logs Device/Tst



Protection set 2/6

Enabled stages

Stages	4
Clear all	-
Clear logs	-
Start counter	0
Trip counter	0
Group	1
SetGrp no ctrl	Keep last
SetGrp priority	1 to 4



3s x tornare alla schermata iniziale

Protection set 2/6

Set. group common change

Stages	4
Clear all	-
Clear logs	-
Start counter	0
Trip counter	0
Group	2
SetGrp no ctrl	Keep last
SetGrp priority	1 to 4



PROTECTION

List of protection enabled

I>	[50/51]
I>>	[50/51]
I>>>	[50/51]
Iq>	[50W/51W]
Arc flash	




Protection set 2/6

Set. group common change

Stages	4
Clear all	-
Clear logs	-
Start counter	0
Trip counter	0
Group	1
SetGrp no ctrl	Keep last
SetGrp priority	1 to 4



Feeder



IL1	0 A
IL2	0 A
IL3	0 A
VL1	0 V
VL2	0 V
VL3	0 V
F	--- Hz

Life Is On

Schneider
Electric

Life Is On

