

Threaded Mounting Foot for QOU Circuit Breakers Ending with Suffix 5251

Retain for future use.

⚠ DANGER

HAZARD OF ELECTRIC SHOCK, BURN, OR EXPLOSION

- This equipment must be installed and serviced only by qualified electrical personnel.
- Turn off all power supplying this equipment before working on or inside equipment.
- Always use a properly rated voltage sensing device to confirm power is off.
- Replace all devices, doors and covers before turning on power to this equipment.

Failure to follow these instructions will result in death or serious injury.

1. Turn off all power supplying this equipment before working on or inside equipment.
2. Turn off circuit breaker.

INSTALLATION

CAUTION

HAZARD OF EQUIPMENT DAMAGE

Improper installation of mounting feet can block vent hole at bottom of circuit breaker. Install mounting feet according to the following instructions.

Failure to follow this instruction can result in equipment damage.

3. Install mounting feet (A) as shown.

NOTE: Always use two mounting feet per pole.

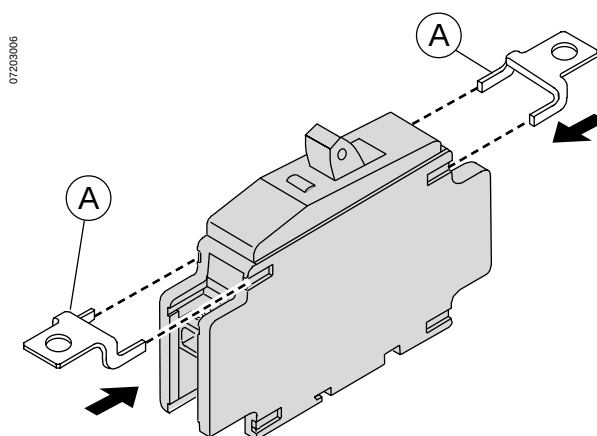


Figure 1: Mounting Feet Installation

⚠ DANGER**HAZARD OF ELECTRIC SHOCK, BURN, OR EXPLOSION**

Machine screw used for mounting must be between 1/8 in. (3.3 mm) and 5/32 in. (4.0 mm) longer than mounting panel thickness.

Failure to follow these instructions will result in death or serious injury.

4. Using #8-32 machine screw (not provided), flush-mount circuit breaker on mounting panel (A) as shown.

NOTE: Do not surface-mount. Circuit breaker with threaded mounting kit is suited for flush-mounting only.

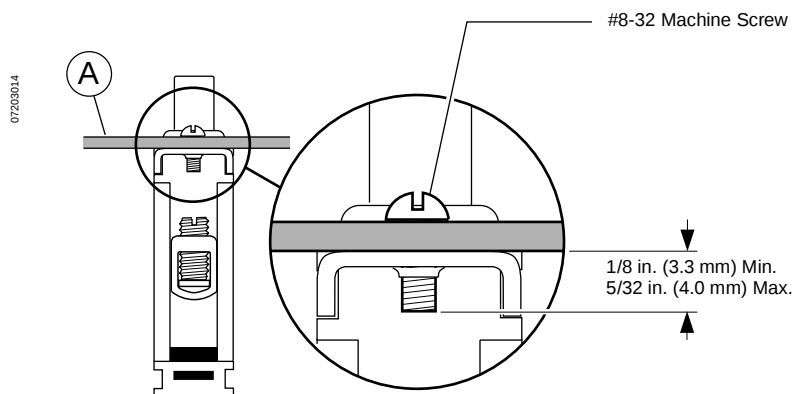


Figure 2: Flush Mounting