



Follow the procedure below to make the Schneider Electric MBX Driver Suite 8.1 compatible with Windows 10. The procedure must be done after installing the suite on Windows 10 but **BEFORE** rebooting the system. If you have rebooted after installing you will need to uninstall and reinstall and then complete the procedure.


1. Start the Windows Registry editor.

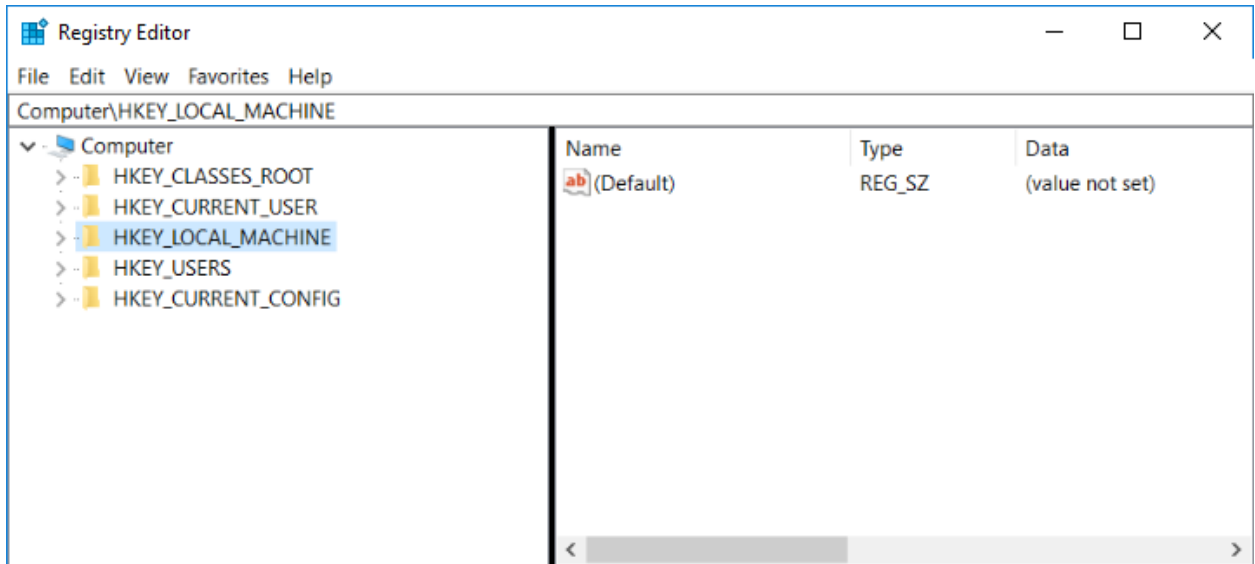


2. Navigate to HKEY\_LOCAL\_MACHINE\SYSTEM\CurrentControlSet\Services\CLMBX.

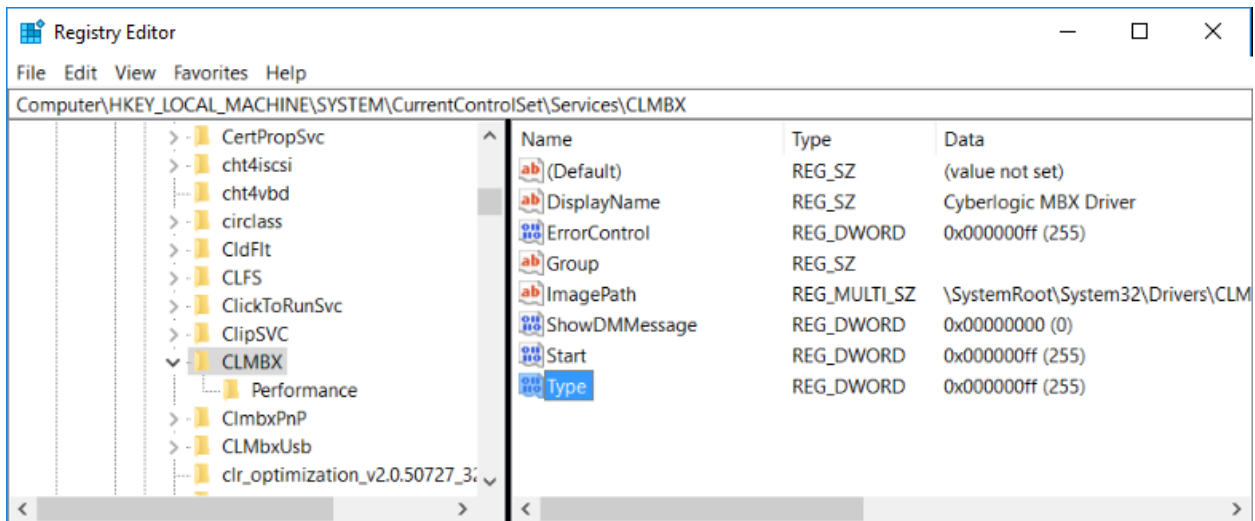


3. The values for ErrorControl, Start and Type all have a value of 255 assigned to them. These values are invalid under Windows 10. The values should be 1 for ErrorControl and Type. The values of Start needs to be set to 4.
4. To change the value double click on ErrorControl. A dialog box will come up allow you to modify the value.

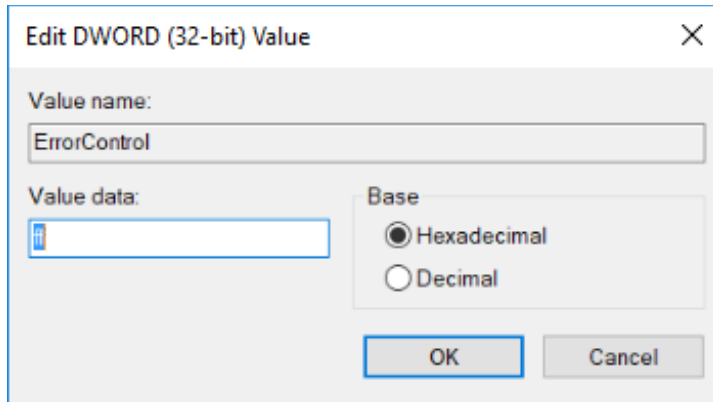

5. In the Value data box enter 1 and click OK.

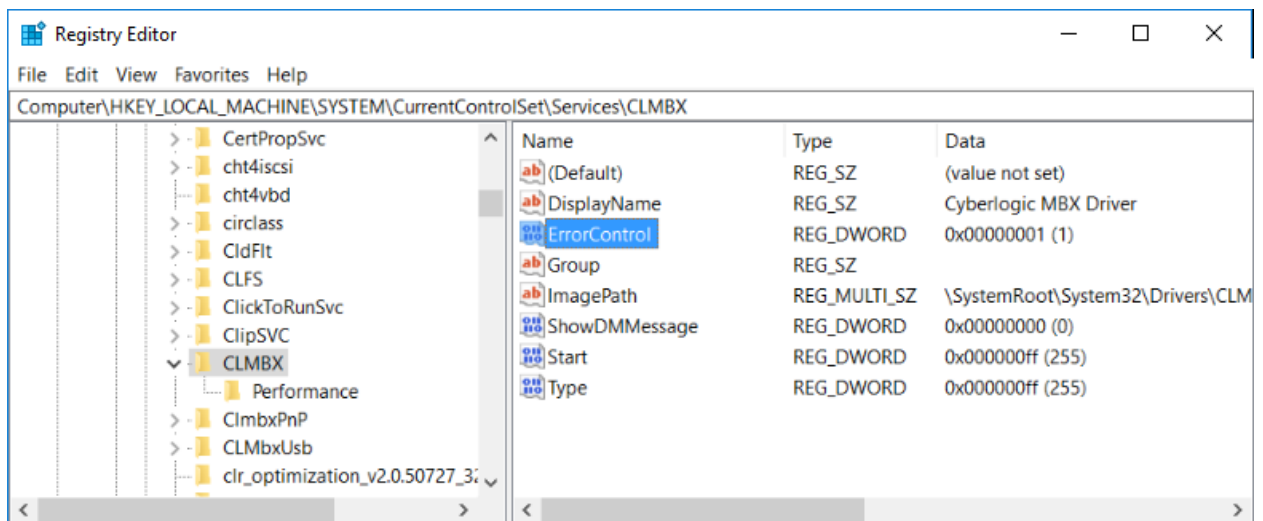

6. Repeat the procedure for the Type value. For the Start value repeat the procedure and enter 4. When you are done the values should look like the screen shot below.

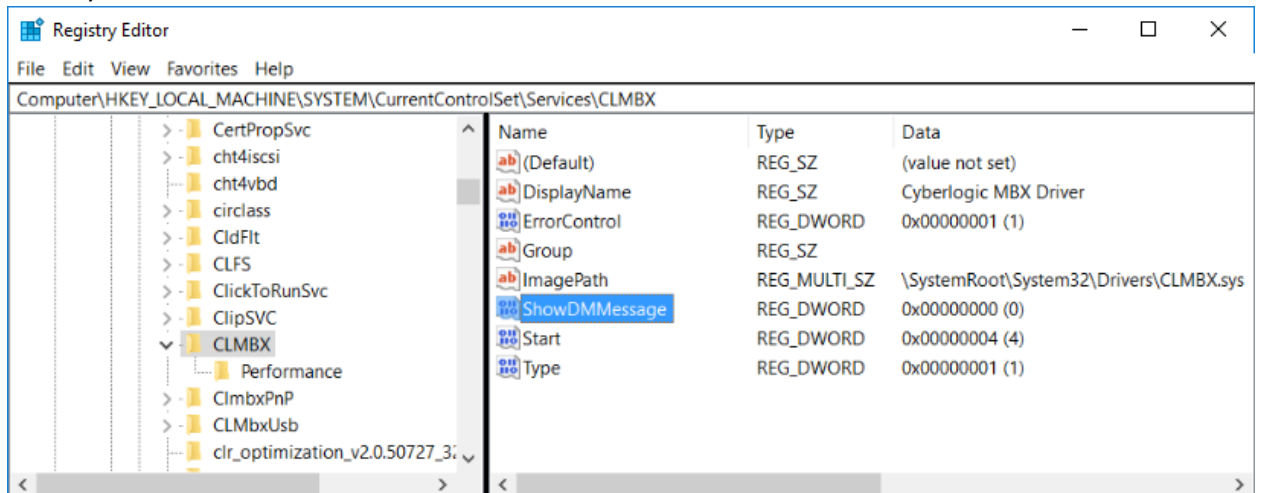

7. Close the registry editor and the system will updated.